

Mounting Hardware

APM50-B1

Antenna Mounting Kits

Applications

The APM50 kits are mounting hardware options to be used for Base Station antennas.

Mechanical Specifications


Pole Diameter: 50-110mm
Weight : 4.5kg

Assembly and Installation

Installation Preparation

1. Check each package against packing list.
2. Observe safe working at heights.
3. Ensure lightning protection is applied.
4. Annual maintenance is recommended to antenna system.

Installation Tools

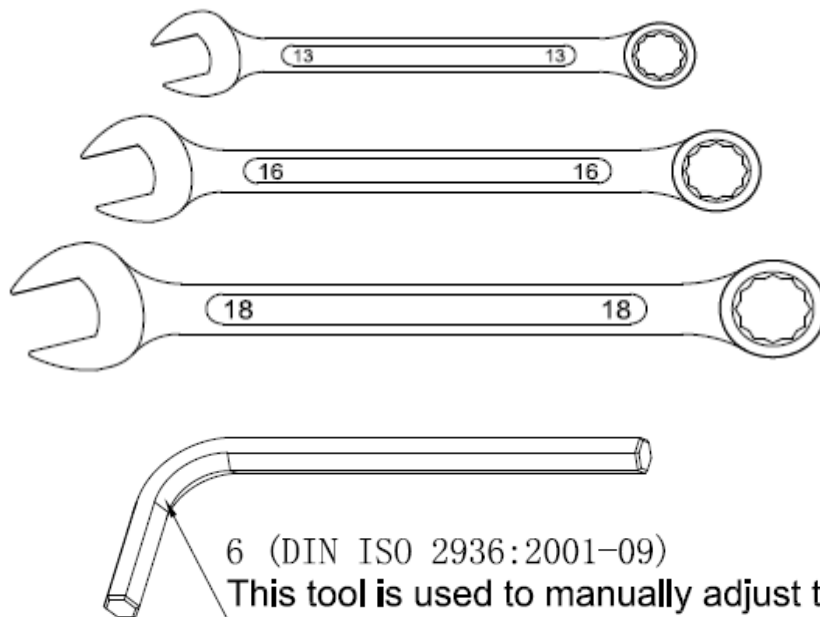

Tightening Nut Torque Values


Nut	Wrench	Torque
M8	13(14)mm	18-22Nm
M10	16(17)mm	32-40Nm
M12	18(19)mm	57-75Nm

Tightening Connector Torque Values

Connector	Torque
4.3-10	18-22Nm
7-16	5-8Nm

Step 1

Pre-assemble the top and bottom mounting brackets. Tighten the U Clamp with M8 bolts (torque 18Nm).

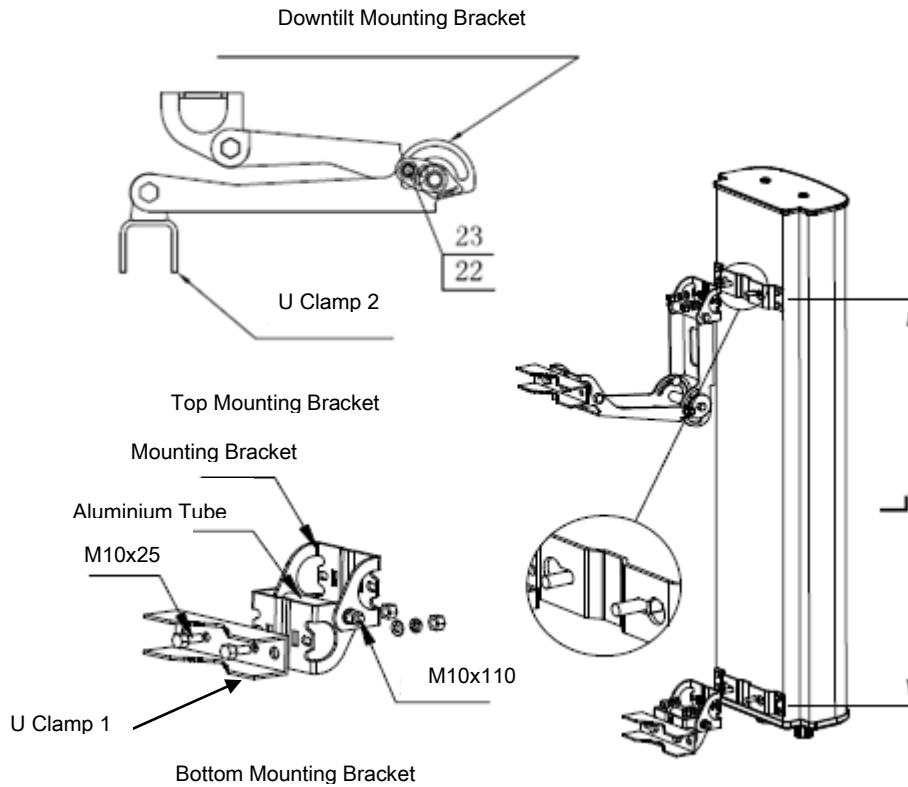

Step 2

Assemble mounting brackets to the antenna with four M8 bolts (torque 18Nm).


Mounting Hardware

APM50-B1

Antenna Mounting Kits


Step 3

- 1) Adjust tilt to 0° and tighten nut A;
- 2) Fasten antenna to pole vertically with M12x150 bolts (torque 57Nm).

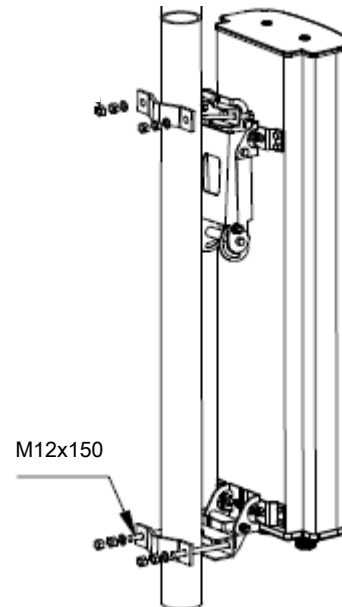

Step 4

Loose nut A and adjust downtilt mounting bracket to achieve required downtilt angle.

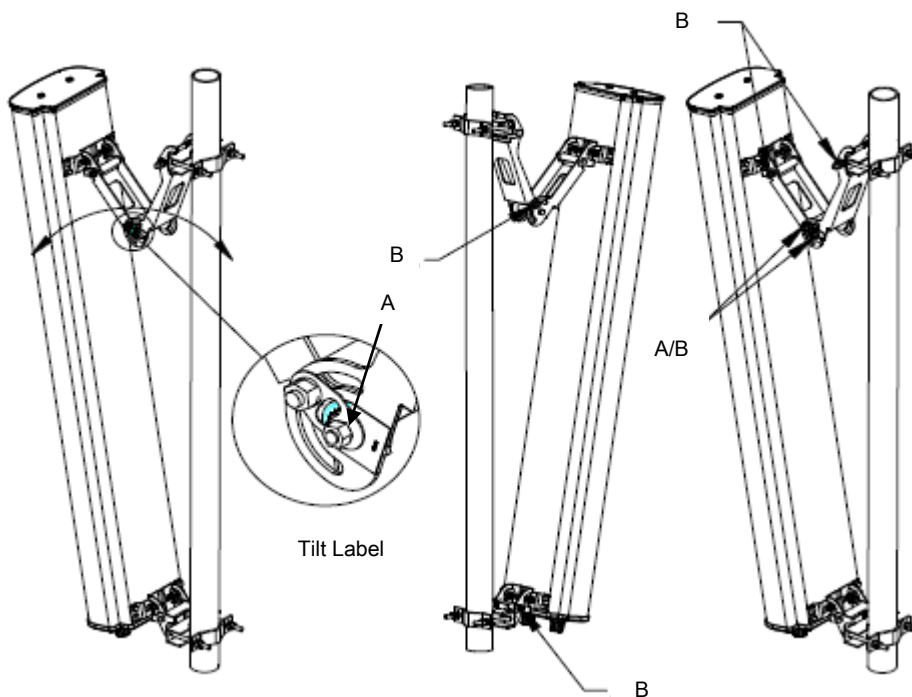

Step 5

Tighten nut A and B to fix antenna downtilt angle (torque 32Nm).

Mounting Hardware

APM50-B1

Antenna Mounting Kits

Antenna Mechanical Downtilt Range

Antenna Length(mm)	Mechanical Downtilt Range(°)
2900	0-7
2520	0-8
2100	0-9
1450	0-12
1365	0-13
1250	0-14
1088	0-16
920	0-20
558	0-30

Material List

No.	Description	Standard	Q'ty	Material
1	Upper Mounting Bracket		1	Q235A t=4
2	Hex Bolt (M10×110)	GB5783-86	4	35 (Hot Galvanizing)
3	Plain Washer (M10)	GB97.1-85	6	304
4	Spring Washer (M10)	GB93-87	6	304
5	Nut (M10)	GB6170-86	6	35 (Hot Galvanizing)
6	Aluminium Tube		4	L2
7	Tilt		1	304(t=1)
8	Square Neck Bolt (M8)	GB/T12	4	304
9	Spring Washer (M8)	GB93-87	5	304
10	Tilt Washer		1	5052(t=1.5)
11	Lower Mounting Bracket		1	Q235A t=4
12	U Clamp 2		1	Q235A t=4
13	Clamp		2	Q235A t=5
14	Hex Bolt (M12×150)	GB5783-86	4	35 (Hot Galvanizing)
15	Plain Washer (M12)	GB97.1-85	4	304
16	Nut (M12)	GB6170-86	8	35 (Hot Galvanizing)
17	U Clamp 1		1	Q235A t=4
18	Mounting Bracket		3	Q235A t=4
19	Hex Bolt (M10×25)	GB5783-86	2	35 (Hot Galvanizing)
20	Plain Washer (M8)	GB97.1-85	4	304
21	Nut (M8)	GB6170-86	4	304
22	Square Neck Bolt (M8)	GB/T12	1	35 (Hot Galvanizing)
23	Nut (M8)	GB6170-86	1	35 (Hot Galvanizing)